



Dart Hawkesbury
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

D412-742-043
Job Sheet 161821



Scooped

Part No: D412-742-043

Job Qty: 1 ea

Part Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 9/30/17

Job Tracking No:

Due Date: 12/1/17

Created By: Mario Poulin

Type: Stock

Description:

Note: DWG REV J SHEETS 1,2 IPP Rev A 05.10.13 New Issue KJ/JLM IPP Rev 06.02.13 ECN 773 dwg @ rev.D
EC IPP Rev:C 07-05-28 As per Rev F JLM IPP Rev:D 07-12-04 ECN 1072 DD verified by:JLM IPP Rev:E 08-
09-08 ecn 08-510 DD verified by:EC IPP Rev:F 11.11.01 as per DSI9517 REV.B DD verified by:EC IPP REV:G
16.05.02 AS PER DWG REV.J DD VERF:JLM

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Due Date	Standard		Workcenter/Supplier	
				Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time
90	Start up Operation	1 Ea	11/30/17	0.00	0.00	Start up container	
100	DC	1 pcs	11/30/17	0.00	0.00	DC	
110	HandFinish	1 pcs	12/1/17	0.00	3.50	HandFinish4	<i>all 12/1/17</i>
120	QC	1 pcs	12/1/17	0.00	0.00	QC5	
130	Packaging	1 pcs	12/1/17	0.00	0.00	Packaging3	
140	QC21-FG	1 Ea	12/1/17	0.00	0.00	QC21	

Part Op 100 - If D412-742-043 is a W/O on it's own, Photocopy bluefile and create labels per PPP D412-742-043 CHG007
Descriptions: 110 - 1-Install tubes together and seal them all the way around using Sikaflex 241/291. Ensure tube ends line-up with saddle holes for proper alignment. using 7/16" "T" Pins. A/R Sikaflex-241/-291 _____ Expiry date: _____
2-Install wearplates as per Dwg D3391. Ensure that plastic washers are against wearplate, then topped with the SS washer. Seal all bolts with sikaflex except ones with inserts on inside of tube ,hand tighten only bolts with no sikaflex. A/R Sikaflex-241/-291 _____ Expiry date: _____ 3-Remove "T" pins once sikaflex is dry.
4-Coat all exposed hardware with LPS Procyon. Remove any excess off with MEK degreaser. A/R LPS Procyon _____
VERIFY FWD AND AFT SADDLE FIT DURING ASSEMBLY BY: _____
DATE: _____
130 - Identify and pack for shipping as per PPP D412-742-043 Location: _____ PPP Rev: _____

Job Allocations

Operation	Component Part	Required	Inventory	Allocated	Std Qty
90-Start up Operation	AN3C4A <i>5002673</i>	24	1,980	0	0
	AN3C6A	4	100	0	0
	AN5C7A <i>5002671</i>	10	97	0	0
	D3391-021 <i>5001349</i>	1	1	0	0
	D3391-023 <i>5002252</i>	1 <i>5003415</i>	0	0	0
	D3391-025 <i>5001191</i>	1 <i>5001191</i>	3	0	0
	D4095-041 <i>F149218</i>	1	14	0	0
	D4095-043 <i>M165840</i>	1	6	0	0
	D4095-045	1	10	0	0
	NAS1149C0332R <i>5007653</i>	28	2,674	0	0
	NAS1149C0532R <i>5002670</i>	10	239	0	0

Part Specifications



S005606



Repl. Skidtube Fits LH or RH, High Gear, DART (Apical)
Tri-Bag Float Comp.

PART NO:
Revision:
Operation:
Quantity:
Change No:

Packaging
1

D412-742-043

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K64 1K7
CANADA
TEL.: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Mfg Date: 11/03/17
Job No: 161821

Work Order ID 161821

Tuesday, May 23, 2017 10:55:38 AM

161821

Page 1

Item ID: D412-742-043

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/15/2017 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals:

Process Plan:

Date:

MAY 23 2017

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D3391

J

100

Document Control

0.00

100

DOCUMENT CONTROL

DC

Memo

0.00

Doc.Control -USB or Paperwork

If D412-742-043 is a W/O on it's own,
Photocopy bluefile and create labels per PPP D412-742-043 CHG007

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Miscellaneous ☐	Past Due ☐																																																																

Work Order ID 161821***161821***

Page 2

Tuesday, May 23, 2017 10:55:38 AM

Item ID: D412-742-043

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/15/2017 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

110

Assemble as per dwg

0.00

110

HandFinishing

HandFinish

Memo

1.89

Hand Finishing

1-Install tubes together and seal them all the way around using Sikaflex 241/291. Ensure tube ends line-up with saddle holes for proper alignment. using 7/16" "T" Pins.
A/RSikaflex-241/-291 _____
Expiry date: _____

2-Install wearplates as per Dwg D3391. Ensure that plastic washers are against wearplate, then topped with the SS washer. Seal all bolts with sikaflex except ones with inserts on inside of tube ,hand tighten only bolts with no sikaflex.

A/RSikaflex-241/-291 _____
Expiry date: _____

3-Remove "T" pins once sikaflex is dry.

4-Coat all exposed hardware with LPS Procyon. Remove any excess off with MEK degreaser.
A/RLPS Procyon _____

VERIFY FWD AND AFT SADDLE FIT DURING ASSEMBLY
BY: _____

DATE: _____

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : ☐							
Misidentified ☐	Past Due ☐								

Work Order ID 161821

Tuesday, May 23, 2017 10:55:38 AM

161821

Page 3

Item ID: D412-742-043

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/15/2017 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: _____

Date: _____

Tooling: _____

Date: _____

Run Start

NR1

QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

120

QC5- Inspect part completeness to step on W/O

0.00

120

QC

Memo

0.02

Quality Control

130

Identify as per dwg & Stock Location: _____

0.00

130

Packaging

Packaging

Memo

0.00

Packaging

Identify and pack for shipping as per PPP D412-742-043

Location: _____

PPP Rev: _____

140

QC21- Final Inspection - Work Order Release

0.00

140

QC

Memo

0.10

Quality Control

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Not Identified ☐	Past Due ☐																																																																

Picklist Print

Tuesday, May 23, 2017 10:55:36 AM

Page 1

Work Order ID: 161821

161821

Parent Item: D412-742-043

D412-742-043

Parent Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017

Required Date: 6/15/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev A 05.10.13 New Issue KJ/JLM
IPP Rev 06.02.13 ECN 773 dwg @ rev.D EC
IPP Rev:C 07-05-28 As per Rev F JLM
IPP Rev:D 07-12-04 ECN 1072 DD verified by:JLM
IPP Rev:E 08-09-08 ecn 08-510 DD verified by:EC IPP Rev:F
11.11.01 as per DSI9517 REV.B DD verified by:EC IPP REV:G 16.05.02
AS PER DWG REV.J DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
AN5C7A		Purchased	No			110	Each	147.0000	10	10			

AN5C7A

BOLT

**

Location	Loc Qty	Loc Code
FG	2	
19185	2	
FP001	67	
m131139	1	
m131320	32	
m132930	24	
m136450	10	
ST338	78	
m132123	10	
m136450	18	
m137507	50	

D3391-021

Manufactured No

110

Each

1.0000

1

1

D3391-021

Fwd Tube Assembly

**

Location	Loc Qty	Loc Code
FG039	1	
147918	1	

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Picklist Print

Tuesday, May 23, 2017 10:55:36 AM

Page 2

Work Order ID: 161821

161821

Parent Item: D412-742-043

D412-742-043

Parent Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017

Required Date: 6/15/2017

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0532R

Purchased

No

110

Each

201.0000

10

10

NAS1149C0532R******

WASHER

LocationLoc QtyLoc Code

FP001

84

m135390

8

m136983

76

GA

42

116513

42

ST266

75

m136192

75

D3391-023

Manufactured

No

110

Each

0.0000

1

1

D3391-023******

Mid Tube Assembly

D3391-025

Manufactured

No

110

Each

2.0000

1

1

D3391-025******

Aft Tube Assembly

LocationLoc QtyLoc Code

FG

1

147933

1

FG039

1

149928

1

Tuesday, May 23, 2017 10:55:36 AM

Shop Packet Print

Page 2

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Picklist Print

Tuesday, May 23, 2017 10:55:36 AM

Page 3

Work Order ID: 161821

161821

Parent Item: D412-742-043

D412-742-043

Parent Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017

Required Date: 6/15/2017

Start Qty: 1.00

Required Qty: 1.00

AN3C4A Purchased No 110 Each 1,226.000 24 24

AN3C4A

Bolt

**

Location Loc Qty Loc Code

FG 20

122814 20

FP001 771

M136450 23

M136740 8

M136986 20

M137075 43

M137164 2

M137361 675

OVER002 400

M137507 150

M137587 250

ST350 35

M135704 35

AN3C6A Purchased No 110 Each 219.0000 4 4

AN3C6A

Bolt

**

Location Loc Qty Loc Code

FG 10

122416 10

FP001 4

m136295 4

OVER002 185

m136781 85

m137361 100

ST350 20

m128704 18

m132767 2

Tuesday, May 23, 2017 10:55:36 AM

Shop Packet Print

Page 3

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Picklist Print

Tuesday, May 23, 2017 10:55:36 AM

Page 4

Work Order ID: 161821

161821

Parent Item: D412-742-043

D412-742-043

Parent Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017

Required Date: 6/15/2017

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

110

Each

5,191.000

28

28

NAS1149C0332R******

WASHER

LocationLoc QtyLoc Code

FP001

2350

m136741

46

m137381

2304

GA

514

m133284

22

m136444

492

ST260a

2200

m135408

0

m135908

200

m136741

0

m137597

2000

ST266

127

m136643

127

D4095-041

Manufactured

No

110

Each

9.0000

1

1

D4095-041******

Wearplate Fwd

LocationLoc QtyLoc Code

FP002

9

149218

3

156390

2

159367

4

D4095-043

Manufactured

No

110

Each

6.0000

1

1

D4095-043******

Wearplate Aft

LocationLoc QtyLoc Code

FP002

6

158921

6

Tuesday, May 23, 2017 10:55:36 AM

Shop Packet Print

Page 4

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date :	Step #:	QTY Effective :			MRB (QSI042) Approval	
Description Work Order Deviation		Disposition				
					Completed By	
					Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : ☐						

Picklist Print

Tuesday, May 23, 2017 10:55:36 AM

Page 5

Work Order ID: 161821

161821

Parent Item: D412-742-043

D412-742-043

Parent Item Name: Repl. Skidtube Fits LH or RH, High Gear, DART (Apical) Tri-Bag Float Comp.

Start Date: 6/13/2017

Required Date: 6/15/2017

Start Qty: 1.00

Required Qty: 1.00

D4095-045

Manufactured No

110

Each

11.0000

1

1

D4095-045

Wearplate Center

Location

Loc Qty

Loc Code

FP002

11

149289

1

154305

6

159875

4

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date :	Step #:	QTY Effective :			MRB (QSI042) Approval	
Description Work Order Deviation		Disposition				
					Completed By	
					Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : ☐						

D3391-041/-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY -041	QTY -043	PART NUMBER	DESCRIPTION
X		D3391-041	FLOAT SKIDTUBE ASSEMBLY
	X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1		D3391-011	FWD TUBE ASSEMBLY
1		D3391-013	MID TUBE ASSEMBLY
1		D3391-015	AFT TUBE ASSEMBLY
	1	D3391-021	FWD TUBE ASSEMBLY
	1	D3391-023	MID TUBE ASSEMBLY
	1	D3391-025	AFT TUBE ASSEMBLY
2	2	D3591-1	BUSHING
4		D3672-3	WASHER
1	1	D4095-041	WEARSHOE
1	1	D4095-043	WEARSHOE
1	1	D4095-045	WEARSHOE
1	1	D4095-047	WEARPAD
1	1	D4095-049	WEARPAD
1	1	D4095-051	WEARSHOE
24	24	AN3C4A	BOLT
4	4	AN3C6A	BOLT
10	10	AN5C7A	BOLT
28	28	NAS1149C0332R	WASHER
10	10	NAS1149C0532R	WASHER
4		MS27039C4-12	SCREW
4		NAS1149C0432R	WASHER





SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 161821 MP

MAY 23 2017


J	INCORPORATED DSI 9733, REFORMAT DRAWING CHANGED CBORE DEPTH (ZN D2-8, D2-9), REVISED TABLES, REPLACED POWDER COAT WITH PAINT	ML	16.01.14
I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A8-4, ZN B8-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B8-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C8 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C8 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9384 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	08.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.08.10
A	NEW ISSUE	PH	05.02.07
REV	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	CP	D3391	SHEET 1 OF 11
APPROVED	CP	TITLE	SCALE
DE APPR.	CP	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2006 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2016-04-28
ECN 16-56

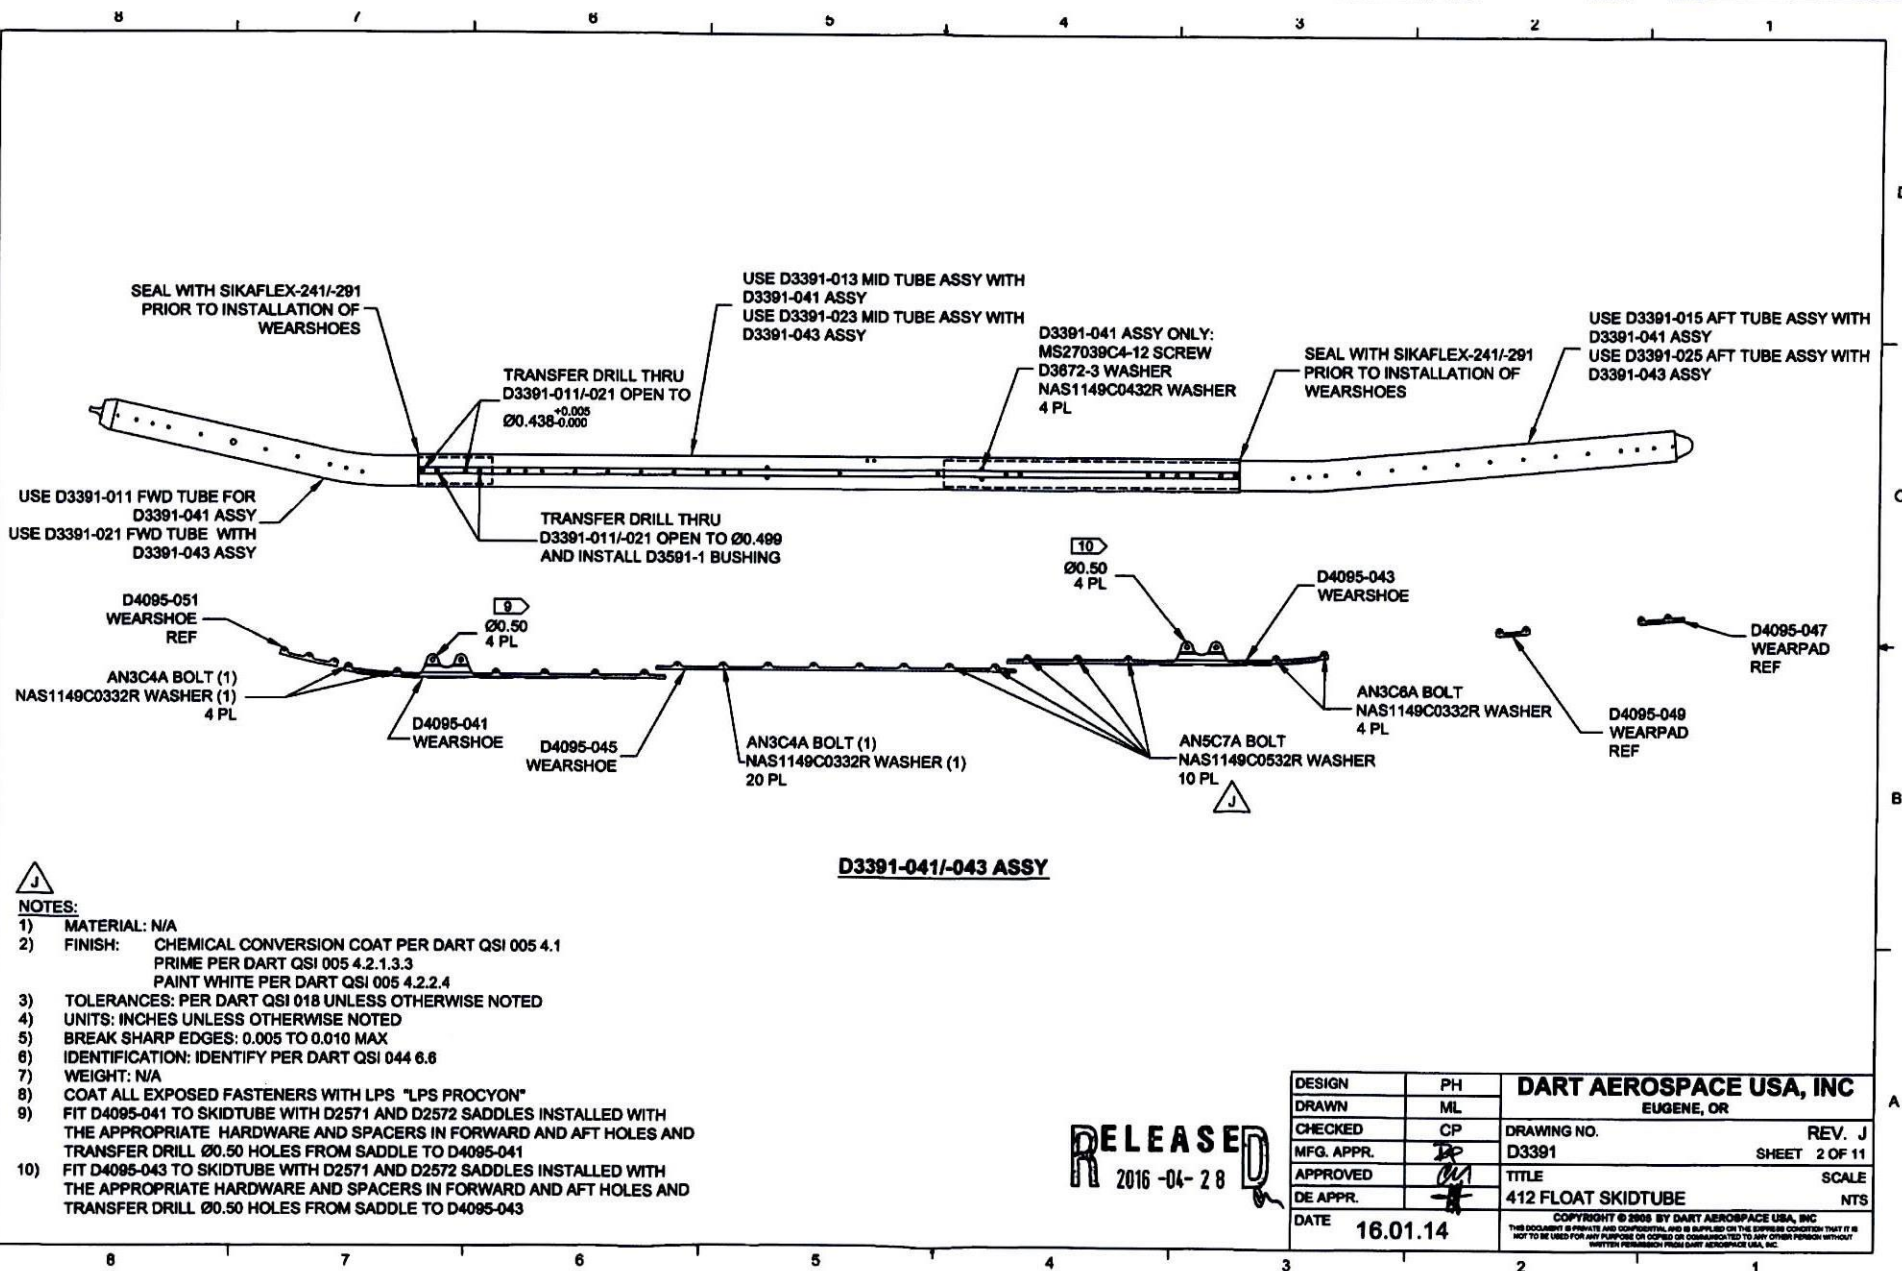

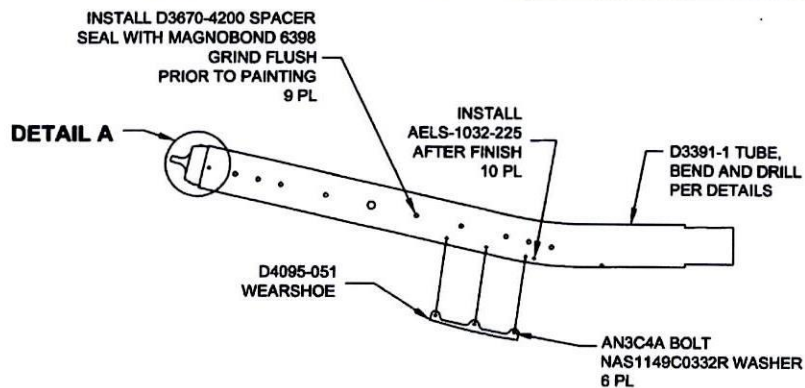


D3391-011 FWD TUBE ASSEMBLY
ASSEMBLY DETAIL

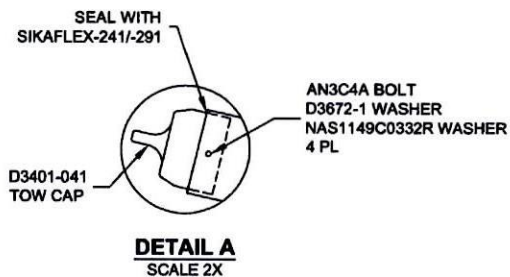


D3391-011 FWD TUBE ASSEMBLY PARTS LIST

QTY -011	PART NUMBER	DESCRIPTION
X	D3391-011	FWD TUBE ASSEMBLY
1	D3391-1	TUBE
1	D3401-041	TOW CAP
9	D3670-4200	SPACER
4	D3672-1	WASHER
1	D4095-051	WEARSHOE
10	AELS-1032-225	INSERT
10	AN3C4A	BOLT
10	NAS1149C0332R	WASHER

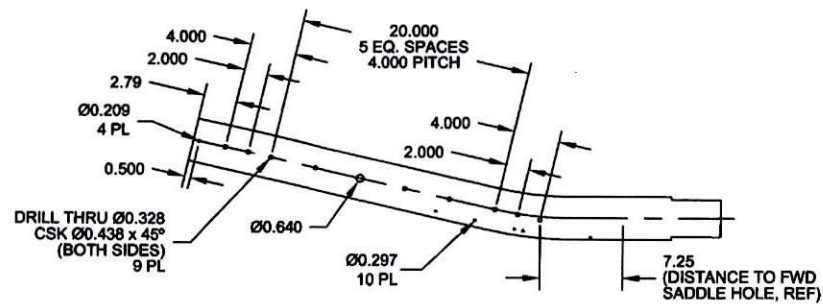

D3391-011 DRILLING DETAIL

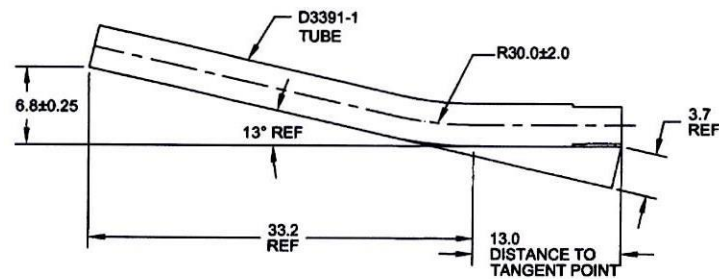

D3391-011 BENDING DETAIL
(MAKE FROM D3391-1)

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 3 OF 11
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
4 PL

DETAIL B




INSTALL
AELS-1032-225
AFTER FINISH
10 PL

D4095-051
WEARSHOE

AN3C4A BOLT
NAS1149C0332R WASHER
6 PL

D3391-021 FWD TUBE ASSEMBLY ASSEMBLY DETAIL

SEAL WITH
SIKAFLEX-241/-291

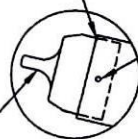


AN3C4A BOLT
D3672-1 WASHER
NAS1149C0332R WASHER
4 PL

D3401-041
TOW CAP


DETAIL B SCALE 2X

D3391-021 FWD TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
-021		
X	D3391-021	FWD TUBE ASSEMBLY
1	D3391-1	TUBE
1	D3401-041	TOW CAP
4	D3670-4200	SPACER
4	D3672-1	WASHER
1	D4095-051	WEARSHOE
10	AELS-1032-225	INSERT
10	AN3C4A	BOLT
10	NAS1149C0332R	WASHER

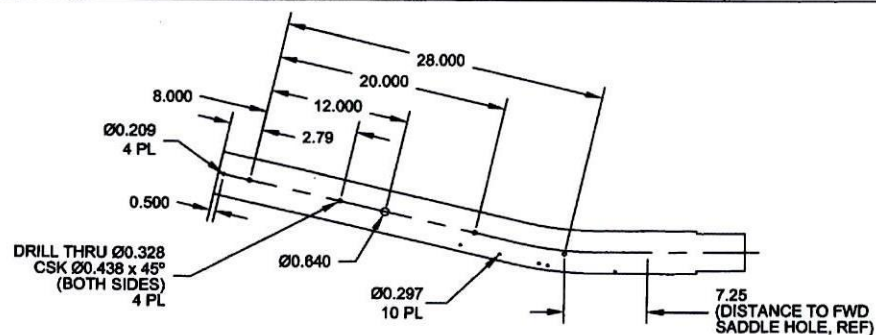


D3391-021 DRILLING DETAIL

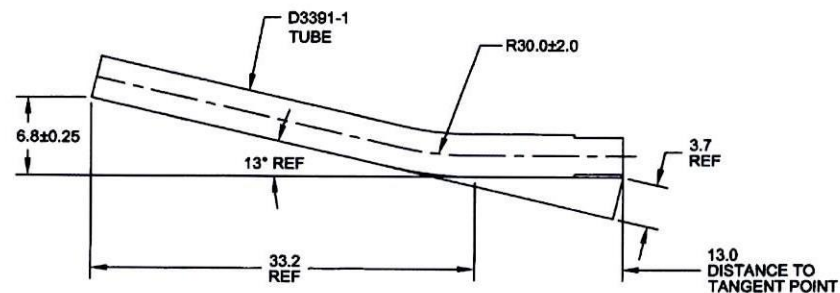

D3391-021 BENDING DETAIL (MAKE FROM D3391-1)


RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	DP	D3391	SHEET 4 OF 11
APPROVED	DP	TITLE	SCALE
DE APPR.	DP	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

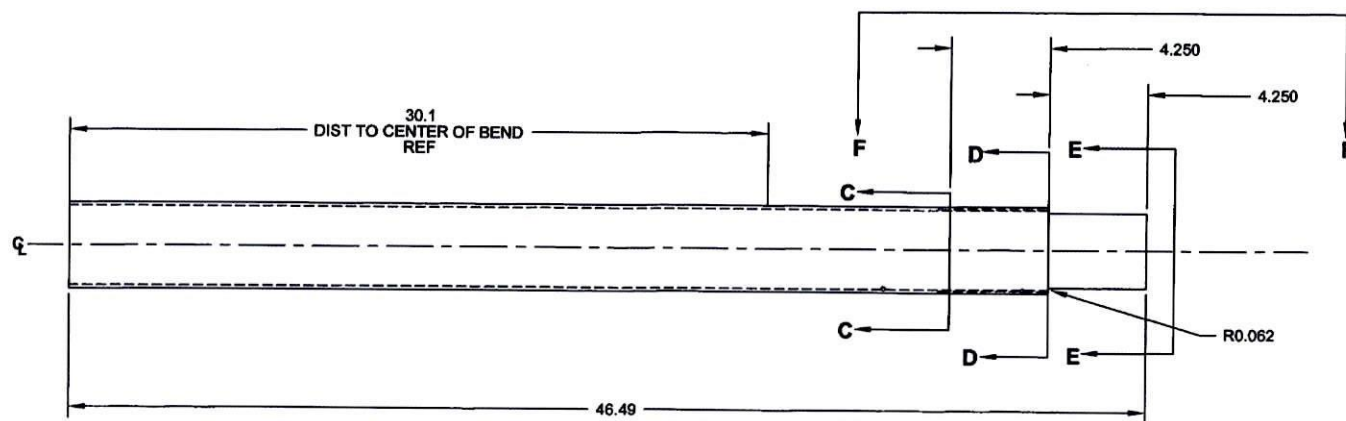


D3391-1 TUBE


(MAKE FROM D8013-047 SKIDTUBE MATERIAL)

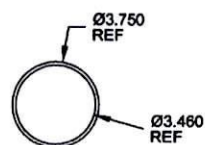


SECTION C-C

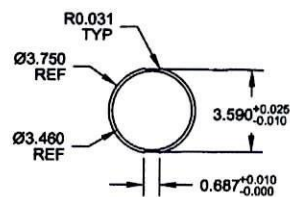

SECTION D-D

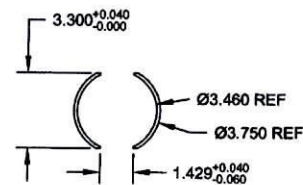


SECTION E-E

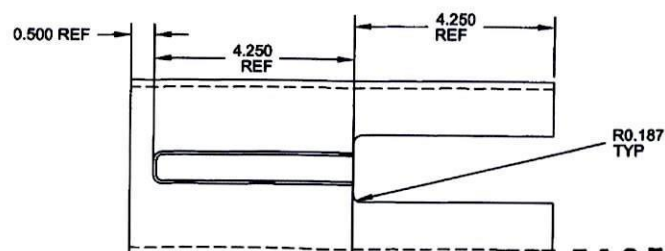


VIEW F-F
SCALE 2X

RELEASED
2016-04-28


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	<i>CP</i>	D3391	SHEET 5 OF 11
APPROVED	<i>ML</i>	TITLE	SCALE
DE APPR.	<i>ML</i>	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

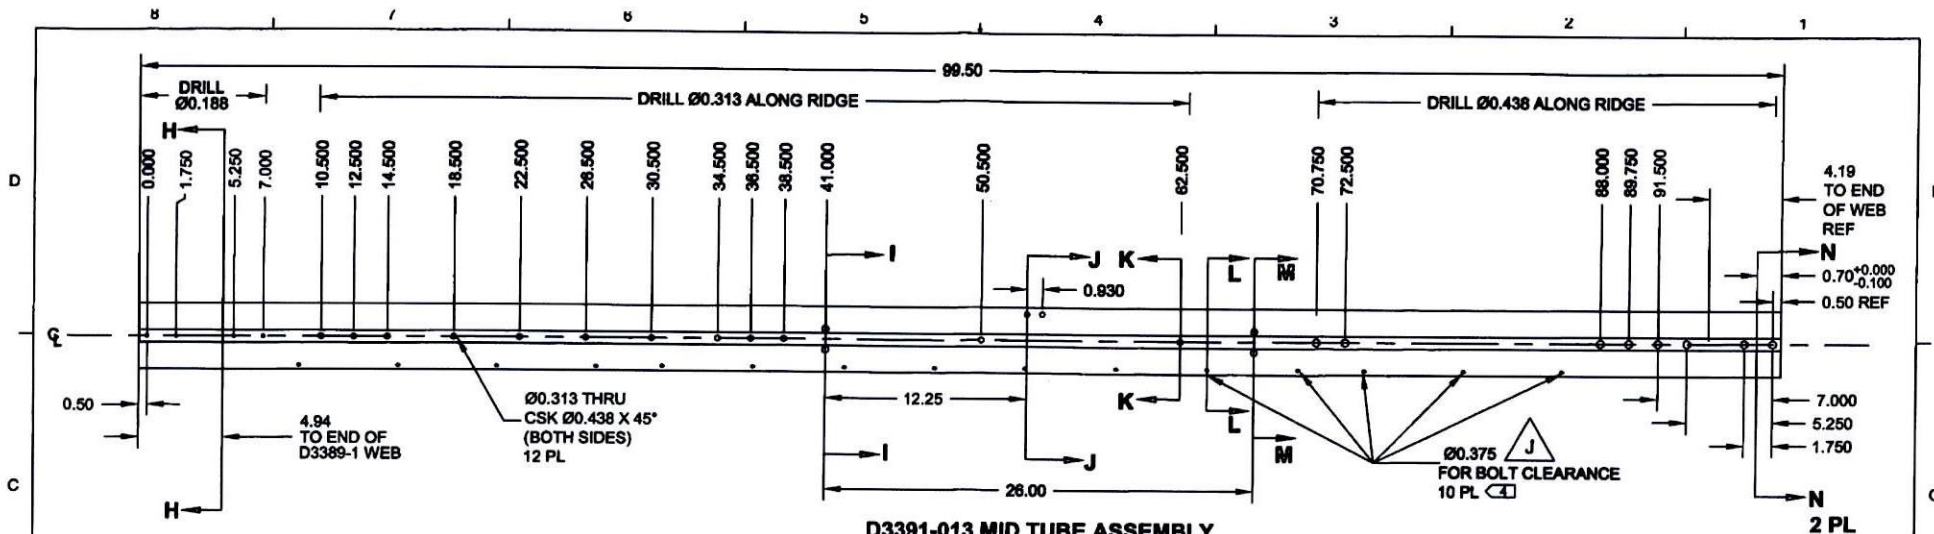

D3391-013 MID TUBE ASSEMBLY

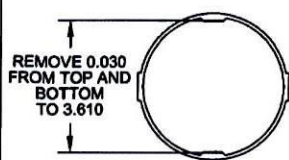


SECTION H-H
SCALE 2X

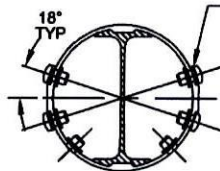


SECTION I-I
SCALE 2X

DRILL Ø0.391
INSTALL ALS4-428-165 INSERT
MS27039C4-08 SCREW
D3672-3 WASHER
NAS1149C0432R WASHER
AFTER FINISH
4 PL

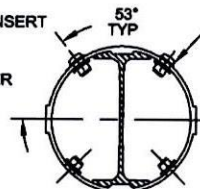

SECTION J-J
SCALE 2X


DRILL Ø0.297
INSTALL AELS-1032-130 INSERT
MS27039C1-09 SCREW
D3672-1 WASHER
NAS1149C0332R WASHER
AFTER FINISH
4 PL <4>

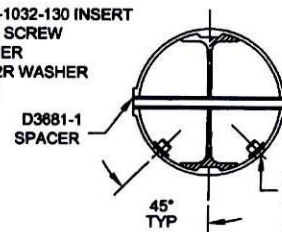

SECTION K-K
SCALE 2X

WELD INTO PLACE
& GRIND FLUSH
(BOTH ENDS)
12 PL <3>


DRILL Ø0.297 <4>
INSTALL AELS-1032-130 INSERT
AFTER FINISH
TYP

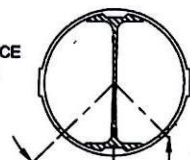

SECTION L-L
SCALE 2X
<4>

D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
1	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW
4	NAS1149C0332R	WASHER
4	NAS1149C0432R	WASHER

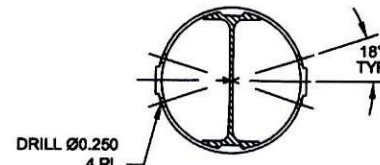

SECTION M-M
SCALE 2X



SECTION N-N
SCALE 2X

REMOVE 0.225 FROM TOP
AND BOTTOM TO 3.800
(0.7 FROM BOTH ENDS)
2 PL



RELEASED
2016-04-28

D3391-013 MID TUBE ASSEMBLY


- 1) MATERIAL: MAKE FROM D2500-1-100
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004
- 4) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES. CBORE AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED.

DESIGN	PH
DRAWN	ML
CHECKED	CP
MFG. APPR.	PA
APPROVED	PA
DE APPR.	PA
DATE	16.01.14


DART AEROSPACE USA, INC	
EUGENE, OR	
DRAWING NO.	REV. J
D3391	SHEET 6 OF 11
TITLE	SCALE
412 FLOAT SKIDTUBE	NTS
COPYRIGHT © 2006 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

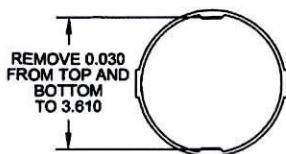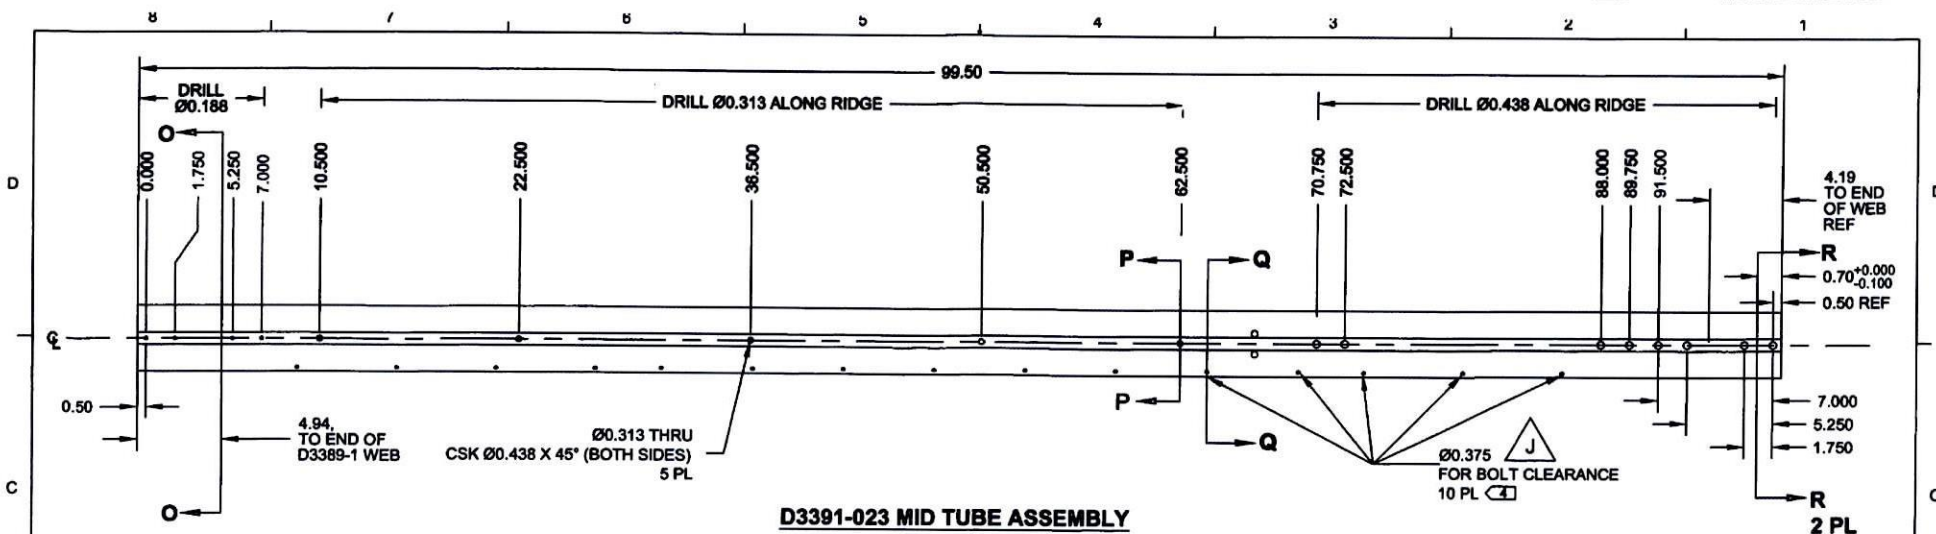


SECTION O-O
SCALE 2X

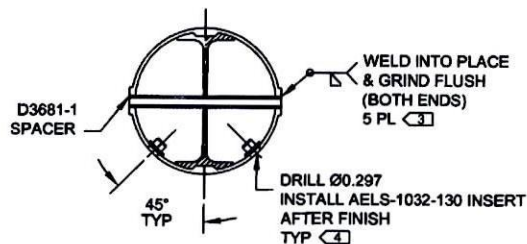

SECTION P-P
SCALE 2X

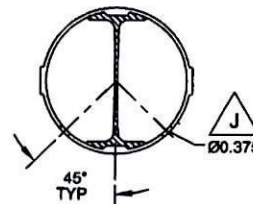

SECTION Q-Q
SCALE 2X

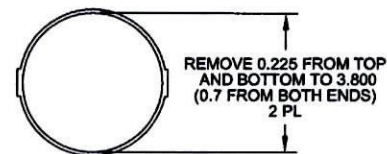

SECTION R-R
SCALE 2X

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY -023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT





D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004
- 4) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES, CBOR AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED.

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 7 OF 11
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2016-04-28

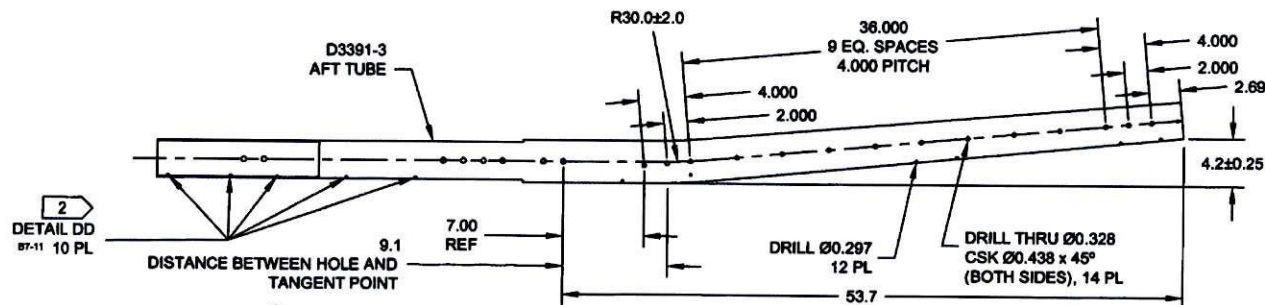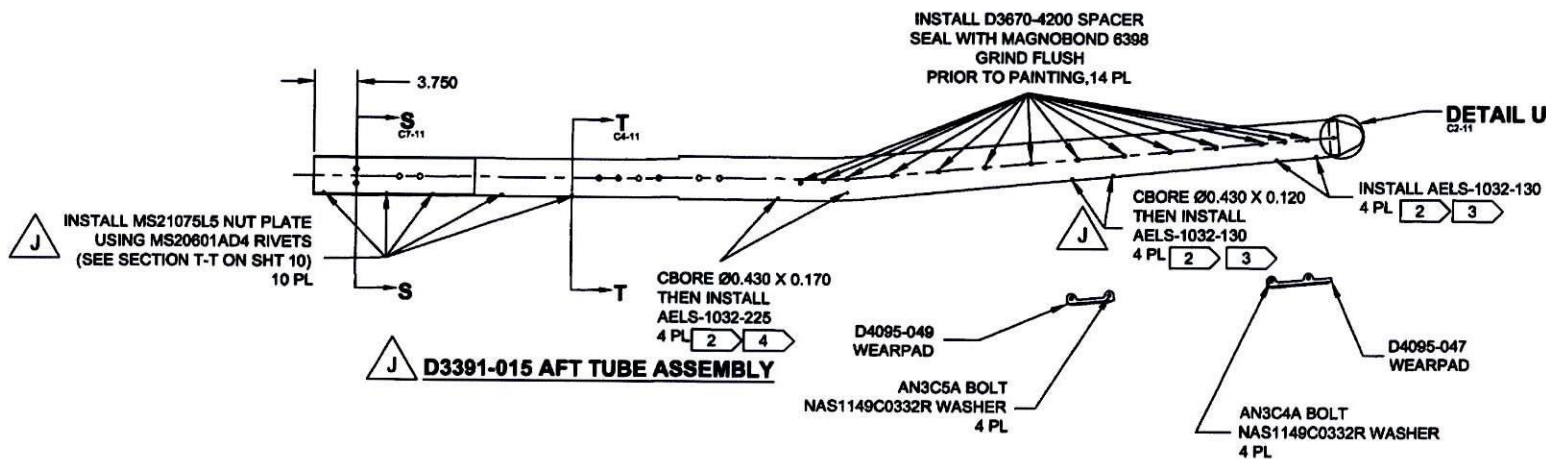

D3391-015 AFT TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-015	AFT TUBE ASSEMBLY
1	D2846	AFT CAP
1	D3391-3	AFT TUBE
14	D3670-4200	SPACER
2	D3672-1	WASHER
1	D4095-049	WEARPAD
1	D4095-047	WEARPAD
6	AELS-1032-130	INSERT
4	AELS-1032-225	INSERT
4	ALS4-428-165	INSERT
6	AN3C4A	BOLT
4	AN3C5A	BOLT
20	MS20601AD4	RIVET, BLIND
10	MS21075L5	NUT PLATE, FLOATING
10	NAS1149C0332R	WASHER



NOTES:

- 1) COAT ALL EXPOSED FASTENERS WITH LPS "LPS PROCYON"
- 2) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES. CBORE AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED.
- 3) ENSURE WALL THICKNESS IS BETWEEN 0.070 AND 0.130 BEFORE INSTALLING INSERT
- 4) ENSURE WALL THICKNESS IS BETWEEN 0.130 AND 0.225 BEFORE INSTALLING INSERT

BENDING AND DRILLING DETAIL

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 8 OF 11
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2008 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

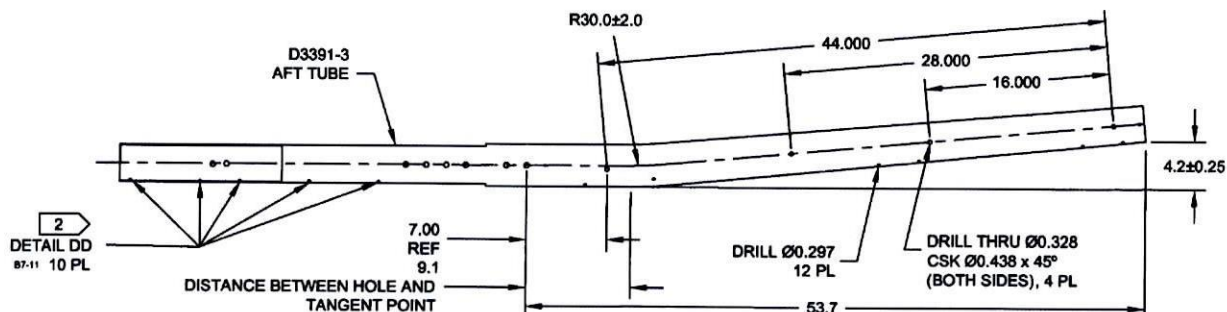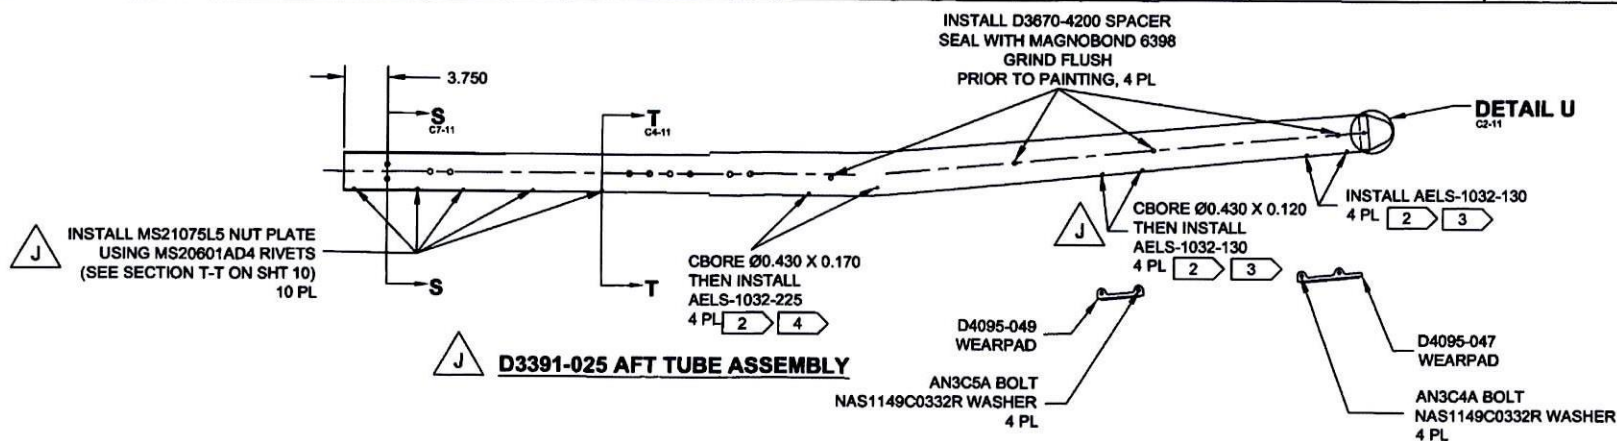

BENDING AND DRILLING DETAIL

D3391-025 AFT TUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-025	AFT TUBE ASSEMBLY
1	D2646	AFT CAP
1	D3391-3	AFT TUBE
4	D3670-4200	SPACER
2	D3672-1	WASHER
1	D4095-049	WEARPAD
1	D4095-047	WEARPAD
8	AELS-1032-130	INSERT
4	AELS-1032-225	INSERT
6	AN3C4A	BOLT
4	AN3C5A	BOLT
20	MS20601AD4	RIVET, BLIND
10	MS21075L5	NUT PLATE FLOATING
10	NAS1149C0332R	WASHER

NOTES:


- 1) COAT ALL EXPOSED FASTENERS WITH LPS "LPS PROCYON"
- 2) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 AND Ø0.375 HOLES FOR WEARSHOE INSERTS AND NUTPLATES. CBORE AS NOTED AND INSTALL INSERT/NUTPLATES EXCEPT WHERE INDICATED. USE NUT PLATE DRILL JIG IF REQUIRED.
- 3) ENSURE WALL THICKNESS IS BETWEEN 0.070 AND 0.130 BEFORE INSTALLING INSERT
- 4) ENSURE WALL THICKNESS IS BETWEEN 0.130 AND 0.225 BEFORE INSTALLING INSERT

RELEASED
2016-04-28


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.		D3391	SHEET 9 OF 11
APPROVED		TITLE	SCALE
DE APPR.		AFT TUBE ASSEMBLY	NTS
DATE	16.01.14	COPYRIGHT © 2006 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

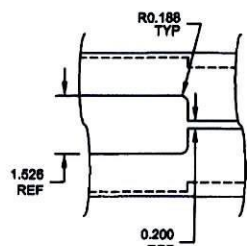


VIEW W-W
SCALE 4X

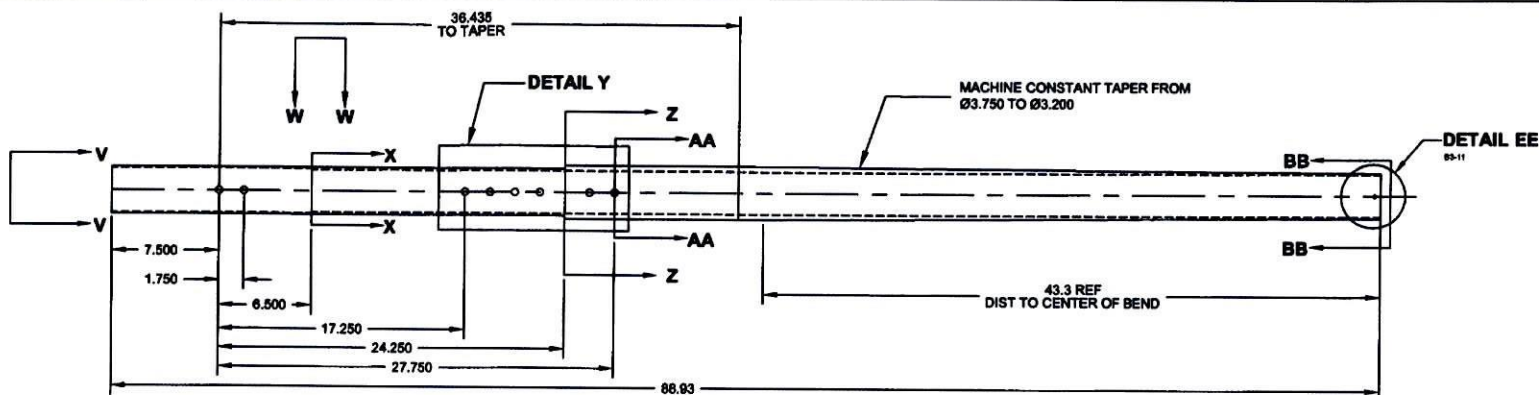


D3391-3 AFT DRILLING AND CUTTING DETAIL
(MAKE FROM D6014-090)

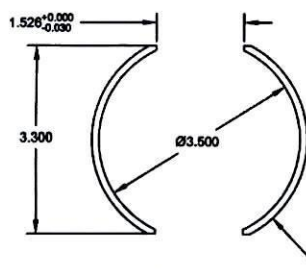


SECTION V-V
SCALE 4X

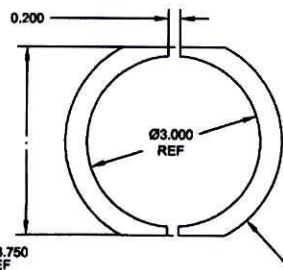


SECTION X-X
SCALE 4X

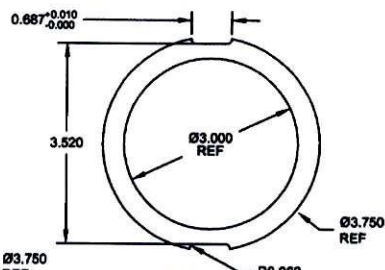


SECTION Z-Z
SCALE 4X

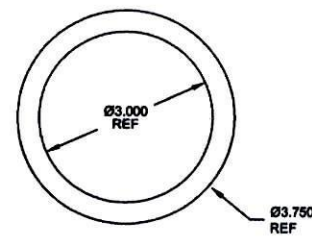


SECTION AA-AA
SCALE 4X

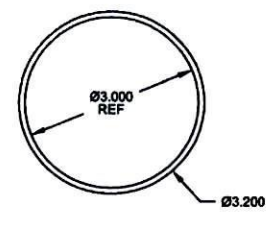

SECTION BB-BB
SCALE 4X

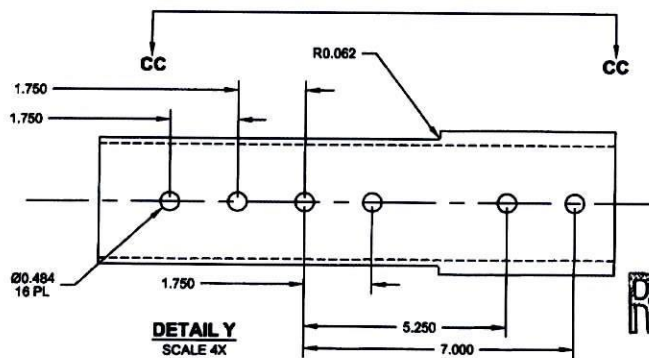


DETAIL Y
SCALE 4X

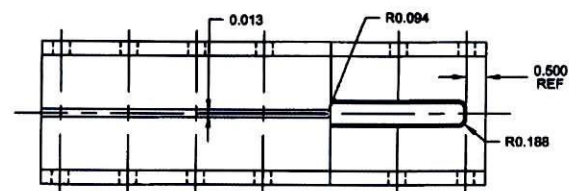

VIEW CC-CC

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	<i>DFC</i>	D3391	SHEET 10 OF 11
APPROVED	<i>DFC</i>	TITLE	SCALE
DE APPR.	<i>DFC</i>	412 FLOAT SKIDTUBE	NTS
DATE	16.01.14	COPYRIGHT © 2006 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRELIMINARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
2016-04-28

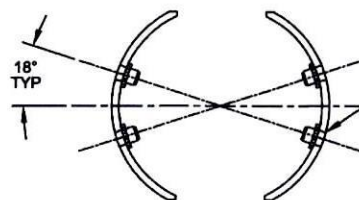


SECTION S-S
SCALE 5X


DRILL Ø0.391
CBORE Ø0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT
4 PL

USE DT8217 DRILL TEMPLATE
TO LOCATE HOLES AND OPEN
TO Ø0.375


MS21075L5 NUTPLATE
REF

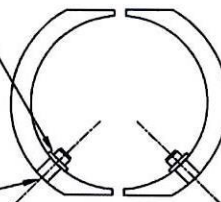


SECTION T-T
SCALE 5X

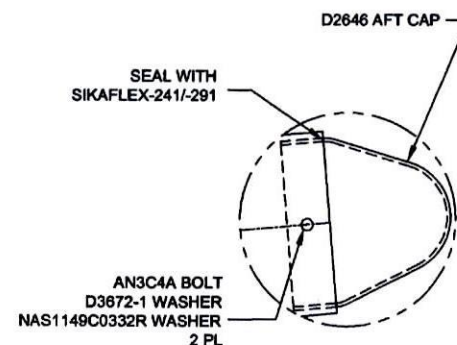

DETAIL U
SCALE 5X

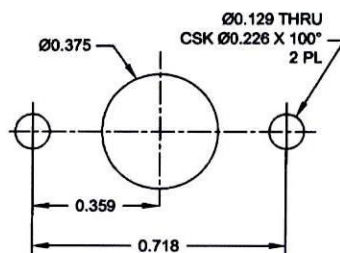

DRILLING DETAIL DD
SCALE 10X

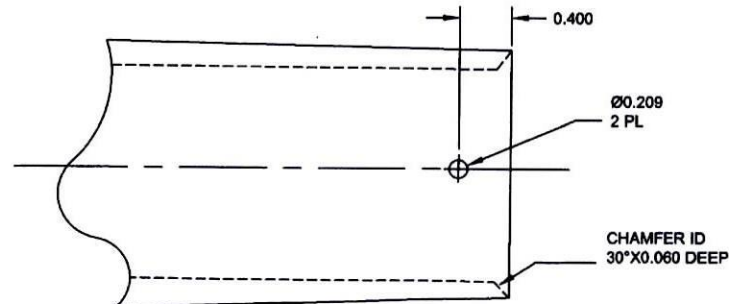

DETAIL EE
SCALE 2X



NOTES:
1) USE INDUSTRY STANDARD NUT PLATE DRILL JIG IF REQUIRED.

RELEASED
2016-04-28

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	ML	EUGENE, OR	
CHECKED	CP	DRAWING NO.	REV. J
MFG. APPR.	YR	D3391	SHEET 11 OF 11
APPROVED	ME	TITLE	SCALE
DE APPR.	ME	AFT TUBE ASSEMBLY	NTS
DATE	16.01.14	COPYRIGHT © 2006 BY DART AEROSPACE USA, INC THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	